
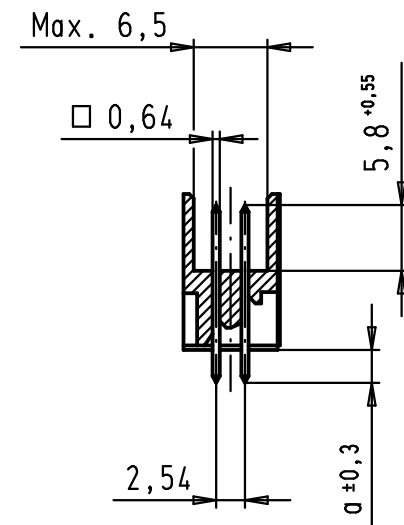


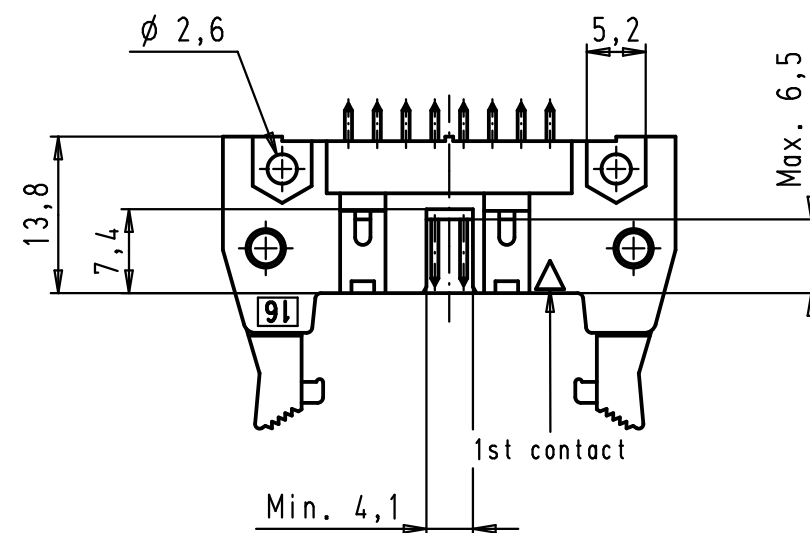

Technical drawing of a contact strip assembly. The drawing shows a side view of a contact strip with a central contact area. Dimensions and tolerances are indicated:

- Top Left:** "All holes" with a tolerance box showing a hole diameter of $\varnothing 0,05$.
- Top Right:** "Min. $\varnothing 2,8$ " with a tolerance box showing a hole diameter of $\varnothing 0,05$.
- Center:** A dashed rectangle labeled "1st contact" containing a grid of 14 small circles (7 rows by 2 columns).
- Dimensions:**
 - Vertical dimension on the left: 2,54 (total height) and 1,52 (height of the contact area).
 - Horizontal dimension across the contact area: 2,54.
 - Horizontal dimension from the left edge to the center of the contact area: 35,56.
 - Horizontal dimension from the center of the contact area to the right edge: 2,54.
 - Horizontal dimension from the center of the contact area to the right edge, multiplied by 7: $2,54 \times 7 = (17,78)$.

				Dat.	Name	 SEK 18 Male Connector Standard 16 poles Straight solder pins Long locking levers	Maßstab/ Scale 1,5:1	
			Detail.	01/12/99	JB			
34900	28/01/08	LP	Insp.					
33451	30/03/06	JMDR	Stand.					
27931	15/06/00	JB	HARTING EURL F-95972 Paris			 All Dim. in mm Orig. Size DIN A 3	TB 09 18 516 X90X Sub.	Blatt/ Page 1 / 2
26554	01/12/99	JB						
Mod.	Dat.	Name						